



**NUMBER:** 18-047-07

**GROUP:** Vehicle Performance

**DATE:** November 13, 2007

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.*

**SUBJECT:**

MIL Illumination Due To Diagnostic Trouble Code P0481 - Cooling Fan 2 Control Circuit

**MODELS:**

2008	(WH)	Grand Cherokee (International Markets)
2008	(WK)	Grand Cherokee
2008	(XH)	Commander (International Markets)
2008	(XK)	Commander

**NOTE: This bulletin applies to vehicles equipped with gas engines only.**

**DISCUSSION:**

A issue was discovered with StarSCAN® version 8.02 when performing the “Vehicle Configuration Update” procedure on the vehicle listed above. This version of the StarSCAN® erroneously set a MIL Illumination for Diagnostic Trouble Code P0481 - Cooling Fan 2 Control Circuit. Version 8.03 of StarSCAN® corrected this condition.

If a vehicle comes in with DTC P0481 - Cooling Fan 2 Control Circuit, ensure the StarSCAN® is operating at version 8.03 and perform a “Vehicle Configuration Update” procedure. Connect the StarSCAN® to the vehicle and with the ignition key in the run position actuate the High Speed Radiator Fan Relay. Read DTC's with the StarSCAN® and if the DTC returns further diagnosis is required. Refer to the appropriate Diagnostic Procedures available in TechCONNECT. If the DTC does not return no further action is required

**NOTE: Always ensure your StarSCAN® is operating at the latest level of software available.**

**POLICY:**

Information only

