



NUMBER: 18-003-08

GROUP: Vehicle Performance

DATE: January 19, 2008

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 18-044-07, DATED OCTOBER 12, 2007, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE THE ADDITION OF YEARS, MODELS AND CLEAN DATES.**

THE StarSCAN® FLASH FILES FOR THIS BULLETIN MUST BE RETRIEVED FROM THE INTERNET.

StarSCAN® SOFTWARE LEVEL MUST BE AT RELEASE 8.04 OR HIGHER FOR THIS BULLETIN.

StarMOBILE STANDALONE MODE OR StarMOBILE DESKTOP CLIENT MAY ALSO BE USED TO PERFORM THIS PROCEDURE.

SUBJECT:

Flash: MIL Illumination Due To Diagnostic Trouble Code P0524 - Engine Oil Pressure Too Low

OVERVIEW:

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software.

MODELS:

2007 - 2008	(DR/DH/DC/D1)	Ram Truck (1500/2500/3500)
2007 - 2008	(HB / HG)	Durango / Aspen
2007 - 2008	(LX)	300 / Magnum / Charger
2007	(LE)	300C/300 Touring (International Markets)
2007	(L2)	300 (China)
2007 - 2008	(WK)	Grand Cherokee
2007 - 2008	(WH)	Grand Cherokee (International Markets)
2007 - 2008	(XK)	Commander
2007 - 2008	(XH)	Commander (International Markets)



Stick with the Specialists™

NOTE: This bulletin applies to the above listed vehicles equipped with a 5.7L engine with MDS (sales code EZB) built before the following dates:

- (HB/HG) built before August 15, 2007 (MDH 0814XX)
- (LX) built before September 14, 2007 (MDH 0914XX)
- (DR) built before August 16, 2007 (MDH 0816XX)
- **** (WK/WH/XK/XH) built before January 8, 2008 (MDH 0108XX)****

SYMPTOM/CONDITION:

The vehicle operator may experience a Malfunction Indicator Lamp (MIL) illumination due to the following Diagnostic Trouble Code (DTC):

- P0524 - Engine Oil Pressure Too Low

DIAGNOSIS:

Using a Scan Tool (StarSCAN®) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If other DTC's are present record them on the repair order and repair as necessary before proceeding further with this bulletin.

If the vehicle operator describes or experiences the Symptom/Condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification

SPECIAL TOOLS / EQUIPMENT REQUIRED:

NPN	Battery Charger
CH9401	StarSCAN® Tool
CH9404D	StarSCAN® Vehicle Cable
CH9409	StarSCAN® Documentation Kit
CH9410	StarSCAN® Ethernet Cable, 12 ft.
CH9412	StarSCAN® Software Update Device Kit
	TechCONNECT PC or equivalent

REPAIR PROCEDURE - USING THE INTERNET TO RETRIEVE THE FLASH FILE:

NOTE: Before performing this Repair Procedure, the operating software in the StarSCAN® must be programmed with software release level 8.04 or higher. The software release level is visible in the blue header at the top of the StarSCAN® screen.

NOTE: The StarSCAN® diagnostic scan tool fully supports Internet connectivity. However, to take advantage of this feature you must first configure the StarSCAN® for your dealership's network. Make sure the StarSCAN® is configured to the dealership's network before proceeding. For instruction on setting up your StarSCAN® for the dealer's network refer to either: "DealerCONNECT > Service > StarSCAN and StarMOBILE tools > Online Documentation", or refer to the StarSCAN® Quick Start Networking Guide. The StarSCAN® Quick Start Networking Guide is also available on the www.dcctools.com website under the "Download Center".

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Open the hood and install a battery charger. Using a voltmeter, verify that the charging rate provides 13.2 - 13.5 volts. Set the battery charger to continuous charge. Do not allow the charger to time out during the flash process. Remove the charger from the battery when the flash process is complete.

NOTE: Do not allow the charging voltage to climb above 13.5 volts during the flash process.

2. Connect the CH9410 StarSCAN® ethernet cable to the StarSCAN® and the dealer's network drop.
3. Connect the CH9404D StarSCAN® vehicle cable to the StarSCAN® and the vehicle.
4. Power ON the StarSCAN®.
5. Turn the ignition switch on.
6. Retrieve the old PCM part number. Using the StarSCAN® at the "Home" screen:
 - a. Select "ECU View"
 - b. Touch the screen to highlight the PCM in the list of modules.
 - c. Select "More Options"
 - d. Select "ECU Flash".
 - e. Record the part number at the top of the "Flash PCM" screen for later reference.
 - f. Select "Browse for New File". Follow the on screen instructions.
 - g. Select "Download to Scantool".
 - h. Select "Close" after the download is complete, then select "Back".
 - i. Highlight the listed calibration.
 - j. Select "Update Controller".
 - k. When the update is complete, select "OK".
7. Verify the part number at the top of the "Flash PCM" screen has updated to the new part number.

NOTE: Due to the PCM programming procedure, a DTC may be set in other modules within the vehicle, if so equipped. Some DTC's may cause the MIL to illuminate. From the "Home" screen select "System View". Then select "All DTCs". Press "Clear All Stored DTCs" if there are any DTCs shown on the list.

NOTE: The following step is required by law when reprogramming a PCM and/or TCM.

- 8. Type the necessary information on the “Authorized Modification Label” p/n 04275086AB and attach near the VECI label (Fig. 1).

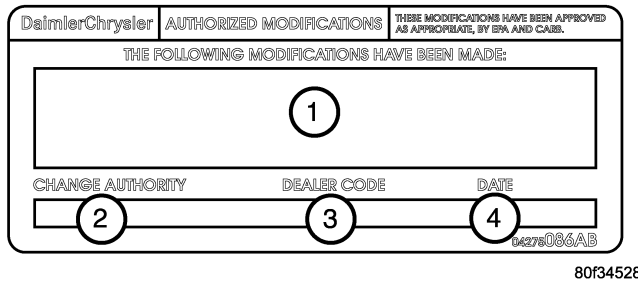


Fig. 1 AUTHORIZED MODIFICATION LABEL

- 1 - POWERTRAIN CONTROL MODULE P/N (INSERT P/N) USED
- 2 - CHANGE AUTHORITY: TSB XX-XXX-XX
- 3 - DEALER CODE: XXXXX
- 4 - DATE: XX-XX-XX

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
18-19-06-99	Module, Powertrain Control (PCM) - Reprogram (B)	0.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------